


5048 Hořák PT-60 6 m PEGAS vysoko-odolný ruční / Torch PT-60 6 m hand HD

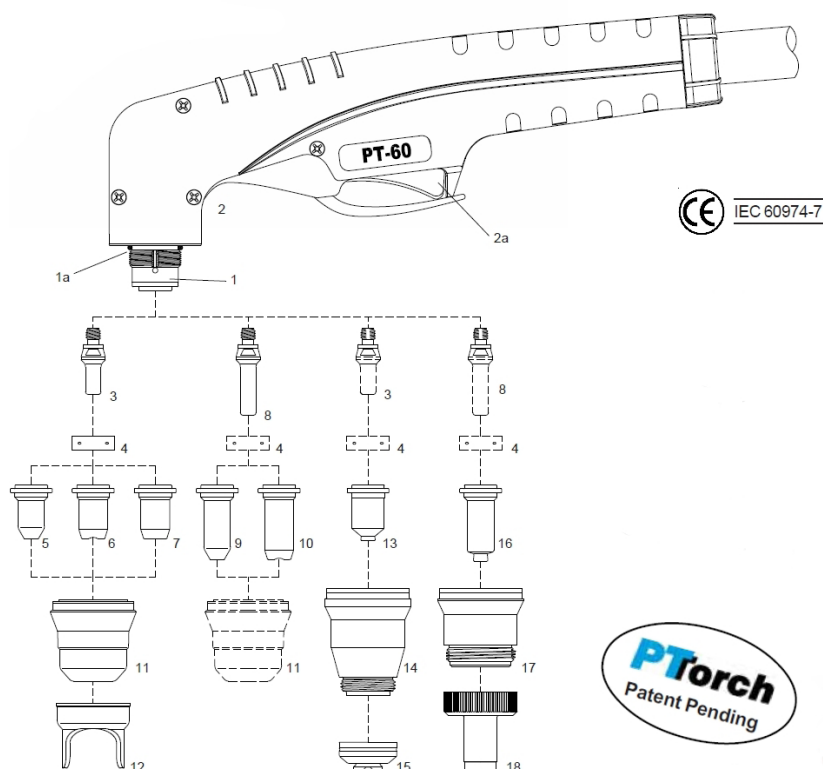

Poz./pos.	Kód/Code	Název / Description	ks/pc
	5085	Sada START k hořáku PT-60 PEGAS / Starting Kit (obsahuje položky viz níže/ contains items see below)	
3	5055	Elektroda standard PT-60 / Electrode, Back Striking	2
5	5058	Dýza 0,8 20/30 A PT-60 / Tip, Contact Cutting, Ø 0.8 (20-30A), Back Striking	4
7	5061	Dýza 1,0 40/50 A flat PT-60 / Tip, Contact Cutting, Ø 1,0 (20-30A), Back Striking	1
8	5063	Elektroda dlouhá PT-60 / Extended Electrode, Back Striking	1
10	5066	Dýza dlouhá 0,9 30/40 A PT-60 / Extended Tip, Contact Cutting, Ø 0.9 BackStriking	2
12	5069	Nástavec vodící PT-60 / Double pointed Spacer	1
Poz./pos.	Kód/Code	Název / Description	
1	5050	Hlava hořáku PT-60 ruční / PT-60 Hand Torch Head 70deg	
1a	5052	O-Kroužek PT-60 / O-Ring	
2	5053	Rukojeť PT-60 / Hand Handle with Switch	
2a	5011	Vypínač PT-100 / Switch	
3	5055	Elektroda standard PT-60 / Electrode, Back Striking	
4	5056	Difuzér PT-60 / Swirl Ring	
5	5058	Dýza 0,8 20/30 A PT-60 / Tip, Contact Cutting, Ø 0.8 (20-30A), Back Striking	
5	5057	Dýza 0,65 10/20 A PT-60 / Tip, Contact Cutting, Ø 0.65 (10-20A), Back Striking	
6	5060	Dýza 0,9 30/40 A PT-60 pos 6 / Tip, Contact Cutting, Ø 0.9 (30-40A), Back Striking	
7	5061	Dýza 1,0 40/50 A flat PT-60 / Tip, Contact Cutting, Ø 1,0 (20-30A), Back Striking	
7	5062	Dýza 1,1 50/60 A flat PT-60 / Flat Tip, Cutting, Ø 1.1 (50-60A), Back Striking	
8	5063	Elektroda dlouhá PT-60 / Extended Electrode, Back Striking	
9	5064	Dýza dlouhá 0,65 10/20 A PT-60 / Extended Tip, Contact Cutting, Ø 0.65 (10-20A), Back Striking	
9	5065	Dýza dlouhá 0,8 20/30 A PT-60 / Extended Tip, Contact Cutting, Ø 0.8 (20-30A), Back Striking	
10	5066	Dýza dlouhá 0,9 30/40 A PT-60 / Extended Tip, Contact Cutting, Ø 0.9 BackStriking	
11	5067	Hubice 6 děr PT-60 / Retaining Cap, 6 holes	
11	5068	Hubice 6 děr Max Life PT-60 / Retaining Cap, 6 holes, Maximum Life	
12	5069	Nástavec vodící PT-60 / Double pointed Spacer	
N/S	5025	Klíč na elektrodu PT-60, 100 / Wrench for Electrode	
13	5070	Dýza 0,9 30/40 A PT-60 pos 13 / Contact Tip, Ø 0.9 (30-40A), Back Striking	
13	5071	Dýza 1,0 40/50 A PT-60 pos 13 / Contact Tip, Ø 1.0 (40-50A), Back Striking	
13	5072	Dýza 1,1 50/60 A PT-60 pos 13 / Contact Tip, Ø 1.1 (50-60A), Back Striking	
14	5073	Hubice PT-60 pos 14 / Shield Cup Body	
15	5074	Hubice PT-60 pos 15 / Shield Cap, Hand	
16	5076	Dýza dlouhá 0,9 40 A PT-60 pos16 / Extended Shielded Tip, Ø 0.9 (40A), Back Striking	
16	5077	Dýza dlouhá 1,0 50 A PT-60 pos16 / Extended Shielded Tip, Ø 1.0 (50A), Back Striking	
16	5078	Dýza dlouhá 1,1 60 A PT-60 pos16 / Extended Shielded Tip, Ø 1.1 (60A), Back Striking	
17	5131	Hubice PT-60 pos 17 / Shield Cup Body pos.17	
18	5132	Dýza 40-60A PT-60 pos18 / Extended Shielded 40-60A PT-60 pos18	
N/S	5081	Kružidlo - sada PT-60 / Circle Cutting Attachment	